

# Part 573 Safety Recall Report

## 22V-069

**Manufacturer Name :** Hyundai Motor America

**Submission Date :** FEB 09, 2022

**NHTSA Recall No. :** 22V-069

**Manufacturer Recall No. :** 219



### Manufacturer Information :

**Manufacturer Name :** Hyundai Motor America

**Address :** 10550 Talbert Avenue

Fountain Valley CA 92708

**Company phone :** 800-633-5151

### Population :

**Number of potentially involved :** 354

**Estimated percentage with defect :** 1 %

### Vehicle Information :

**Vehicle 1 :** 2020-2021 Hyundai Accent

**Vehicle Type :** LIGHT VEHICLES

**Body Style :** 4-DOOR

**Power Train :** GAS

**Descriptive Information :** 354 model year 2020-2021 Accent vehicles produced on March 25, 2020 through July 28, 2020 by Kia Motors Mexico ("KMM") for sale in the U.S. market.

**Production Dates :** MAR 25, 2020 - JUL 28, 2020

**VIN Range 1 : Begin :**

NR

**End :** NR

Not sequential

### Description of Defect :

**Description of the Defect :** The front driver-side and/or passenger-side seat belt pretensioners in the subject vehicles were installed from a suspect production lot containing pyrotechnic-type pretensioners that may deploy abnormally during a crash. At the time of this filing, the cause of the abnormal deployment is unknown. Hyundai is recalling vehicles equipped with pretensioners produced within the same production lot to conduct a detailed part return analysis. The part inspections and investigation will actively continue to determine if a specific root cause and defect trend exists.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** An abnormal pyrotechnic pretensioner deployment could cause metal fragments to enter the vehicle occupant compartment, which may result in injury to vehicle occupants.

**Description of the Cause :** Hyundai is actively investigating root cause.

**Identification of Any Warning that can Occur :** None.

**Involved Components :**

Component Name 1 : S/BELT ASSY-FR P/TENSR 3PT LH/RH

Component Description : Seat belt assembly w/ pretensioner for driver's side & Passenger' side

Component Part Number : 88810J0600

**Supplier Identification :****Component Manufacturer**

Name : Samsung

Address : Jungdong St, 62-30

Seongsan-gu Changwon, Gyeongnam Foreign States 51553

Country : Korea, Republic of

**Chronology :**

See Attachment A for the requested chronology of events.

**Description of Remedy :**

Description of Remedy Program : Hyundai Motor America plans to notify owners of affected vehicles by first class mail with instructions to bring their vehicles to a Hyundai dealer to have the seat belt pretensioner(s) replaced. This remedy will be offered at no cost for all affected customers. All returned pretensioners will be collected for further analysis into root cause.

How Remedy Component Differs from Recalled Component : N/A

Identify How/When Recall Condition was Corrected in Production : N/A

**Recall Schedule :**

Description of Recall Schedule : Dealers and owners will be notified in accordance with the remedy schedule of Recall 211.

Planned Dealer Notification Date : FEB 25, 2022 - FEB 25, 2022

Planned Owner Notification Date : FEB 25, 2022 - FEB 25, 2022

\* NR - Not Reported